

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-000034**Date Inspected:** 08-Dec-2006**Project Name:** SAS Superstructure**OSM Arrival Time:** 800**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1700**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Huang Wei**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** N/A**Summary of Items Observed:**

Office of Structural Materials Quality Assurance Inspector (QA), Mark Wright observed quality control functions related to procedure qualification (PQR) testing at the ZPMC facility in Shanghai, China for the San Francisco Oakland Bay Self Anchored Suspension Bridge.


Item	Description	WBS	Dwg No.	Status
------	-------------	-----	---------	--------

1

The QA Inspector observed welding of a Procedure Qualification (PQR) test plate identified as HP-2006107-3. The test was conducted using Flux Cored Arc Welding (FCAW), Hyundai Supercored 71H, electrode in the 1G (flat) position to AWS D1.5, Section 5.12.1 (Maximum Heat Input). The QA Inspector observed ZPMC Quality Control (QC) recording the essential variable (amps, volts, travel speed) for each pass and randomly verified the parameters using an Amprobe® amperage / voltage meter and a stopwatch. The welding appeared to comply with the contract documents. See TL-6032 for details of this test

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

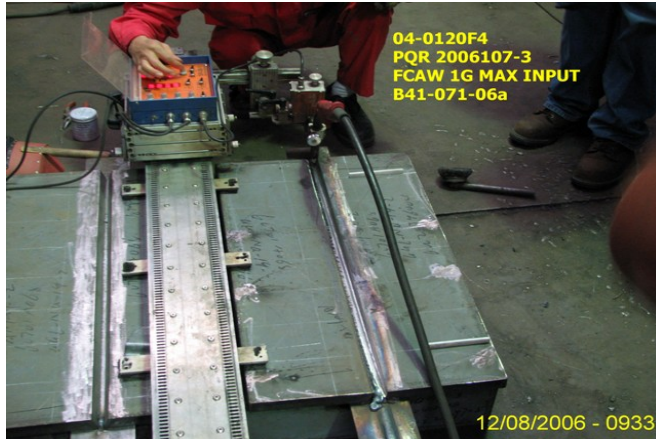

Summary of Conversations:

The QC Inspector with ZPMC Quality Control (QC) stated the RT film for PQR HP-2006107-3 would be ready after lunch time for the QA to review.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh, (818) 292-0659,, who represents the Office of Structural Materials for your project.

Inspected By:	Wright,Mark	Quality Assurance Inspector
----------------------	-------------	-----------------------------

Reviewed By:	McClary,David	QA Reviewer
---------------------	---------------	-------------